


SD5500



Compressed air meter

SDR14DGXFRKG/US-100

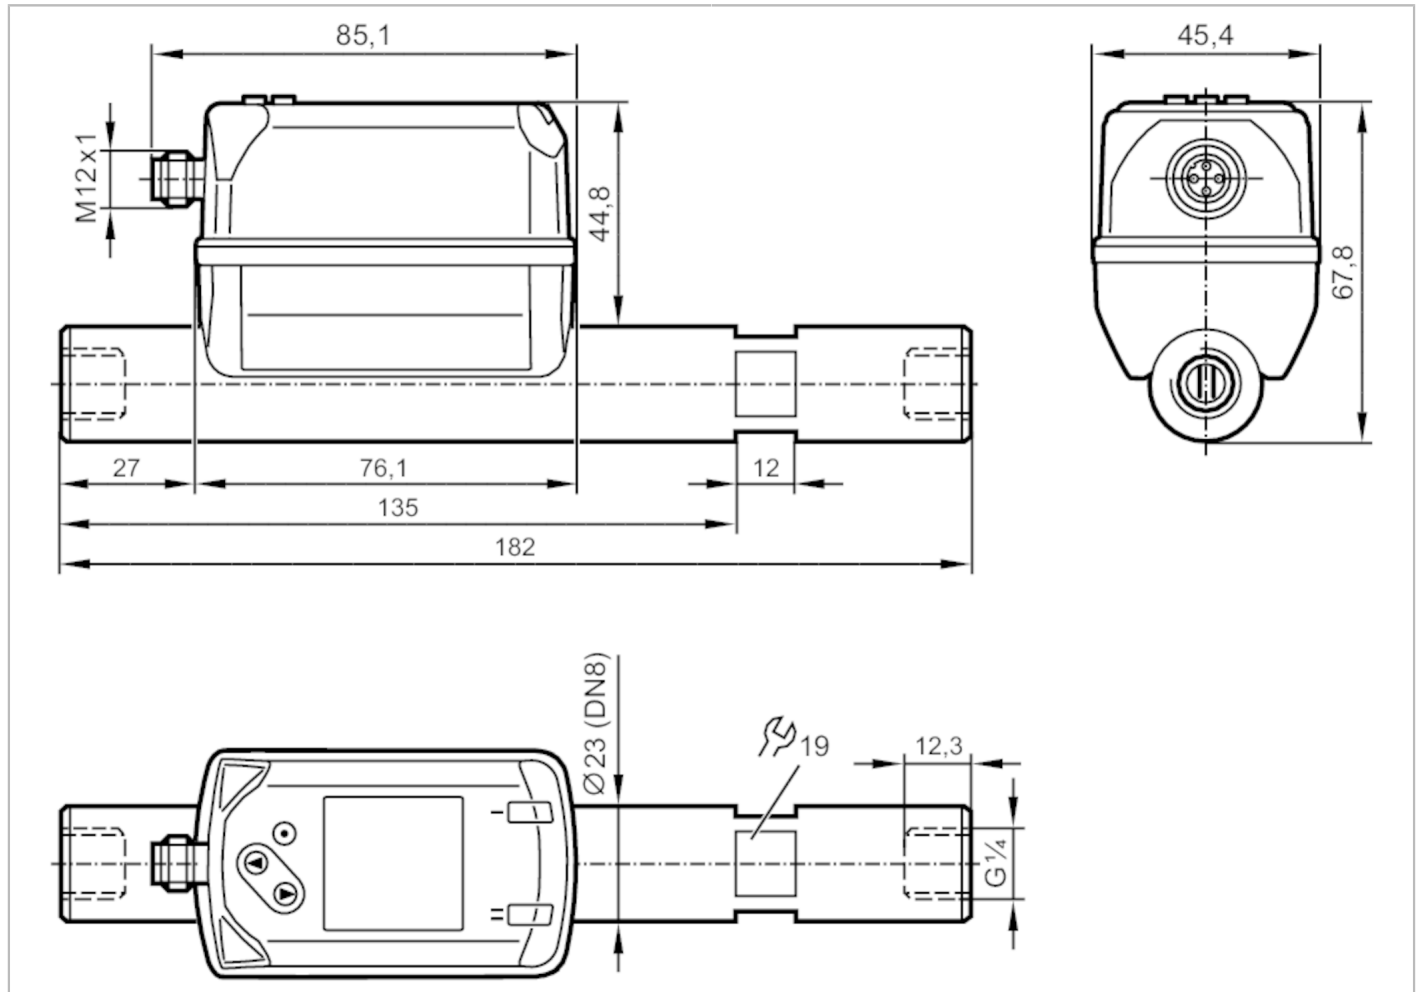

Product characteristics	
Number of inputs and outputs	Number of digital outputs: 2; Number of analog outputs: 1
Process connection	threaded connection G 1/4 DN8
Temperature monitoring	
Measuring range	-10...60 °C 14...140 °F
Application	
Application	for industrial applications
Media	compressed air
Medium temperature [°C]	-10...60
Min. bursting pressure [bar]	64
Min. bursting pressure [MPa]	6.4
Pressure rating [bar]	16
Pressure rating [Mpa]	1.6

SD5500



Compressed air meter

SDR14DGXFRKG/US-100

Electrical data				
Operating voltage	[V]	18...30 DC; (according to EN 50178 SELV/PELV)		
Current consumption	[mA]	< 80		
Protection class		III		
Reverse polarity protection		yes		
Power-on delay time	[s]	1		
Inputs / outputs				
Number of inputs and outputs		Number of digital outputs: 2; Number of analog outputs: 1		
Inputs				
Inputs		counter reset		
Outputs				
Output signal		switching signal; analog signal; pulse signal; IO-Link; (configurable)		
Electrical design		PNP/NPN		
Number of digital outputs		2		
Output function		normally open / closed; (configurable)		
Max. voltage drop switching output DC	[V]	2.5		
Permanent current rating of switching output DC	[mA]	150; (per output)		
Number of analog outputs		1		
Analog current output	[mA]	4...20; (scalable)		
Max. load	[Ω]	500		
Pulse output		consumed quantity meter		
Short-circuit protection		yes		
Type of short-circuit protection		yes (non-latching)		
Overload protection		yes		
Measuring/setting range				
Measuring range		0.8...250 l/min	0.3...82.9 m/s	0.05...15 m ³ /h
Display range		0...300 l/min	0...99.5 m/s	0...18 m ³ /h
Resolution		0.2 l/min	0.1 m/s	0.01 m ³ /h
Set point SP		2.2...249.9 l/min	0.7...82.9 m/s	0.13...14.99 m ³ /h
Reset point rP		0.9...248.7 l/min	0.3...82.5 m/s	0.06...14.92 m ³ /h
Analog start point ASP		0...200 l/min	0...66.3 m/s	0...12 m ³ /h
Analog end point AEP		50...250 l/min	16.6...82.9 m/s	3...15 m ³ /h
Low flow cut-off LFC		0.3...2.7 l/min	0.1...0.9 m/s	0.02...0.16 m ³ /h
In steps of		0.1 l/min	0.1 m/s	0.01 m ³ /h

SD5500



Compressed air meter

SDR14DGXFRKG/US-100

Pressure monitoring		
Measuring range	[bar]	-1...16
Display range	[bar]	-1...20
Resolution	[bar]	0.05
Set point SP	[bar]	-0.92...16
Reset point rP	[bar]	-1...15.92
Analog start point	[bar]	-1...12.8
Analog end point	[bar]	2.2...16
In steps of	[bar]	0.01
Volumetric flow quantity monitoring		
Measuring range		0...100000000 m ³ 0...353146667.2 scf
Display range		0...100000000 m ³ 0...353146667.2 scf
Set point SP		0.001...10000000 m ³ 0.05...353146667.2 scf
Pulse value		0.001...10000000 m ³ 0.05...353146667.2 scf
In steps of		0.0001 m ³ 0.005 scf
Pulse length	[s]	0.01...2
Temperature monitoring		
Measuring range		-10...60 °C 14...140 °F
Display range		-24...74 °C -11.2...165.2 °F
Resolution		0.2 °C 0.5 °F
Set point SP		-9.7...60 °C 14.6...140 °F
Reset point rP		-10...59.7 °C 14...139.4 °F
Analog start point		-10...46 °C 14...114.8 °F
Analog end point		4...60 °C 39.2...140 °F
In steps of		0.1 °C 0.1 °F
Accuracy / deviations		
Temperature coefficient	[1/K]	± 0,07 % MW
Accuracy (in the measuring range)		class 141: ± (2 % MW + 0,5 % MEW); class 344: ± (6 % MW + 0,6 % MEW) ; air quality to ISO 8573-1:2010; at medium temperature 23 °C
Repeatability		± (0,4 % MW + 0,1 % MEW)
Pressure monitoring		
Repeatability	[% of the final value]	± 0,2
Characteristics deviation	[% of the final value]	< ± 0,5; (BFSL = Best Fit Straight Line)
Greatest TEMPCO of the span	[% MEW / 10 K]	± 0,15
Greatest TEMPCO of the zero point	[% MEW / 10 K]	± 0,25
Temperature monitoring		
Accuracy	[K]	± 0,5; (medium flow in the limit area of the flow measurement range)
Reaction times		
Response time	[s]	0.1; (dAP = 0)
Damping for the switching output dAP	[s]	0...5

SD5500



Compressed air meter

SDR14DGXFRKG/US-100

Pressure monitoring		
Response time	[s]	0.05
Temperature monitoring		
Dynamic response T05 / T09	[s]	T09 = 0,5
Software / programming		
Parameter setting options	hysteresis / window; normally open / closed; current/pulse output; display can be rotated and switched off; Display unit; totalizer	
Interfaces		
Communication interface	IO-Link	
Transmission type	COM2 (38,4 kBaud)	
IO-Link revision	1.1	
SDCI standard	IEC 61131-9 CDV	
Profiles	Digital Measuring Sensor (0x800A), Identification and Diagnosis (0x4000)	
SIO mode	yes	
Required master port class	A	
Process data analogue	8	
Process data binary	2	
Min. process cycle time	[ms]	7.2
Supported DeviceIDs	Type of operation	DeviceID
	default	860
Operating conditions		
Ambient temperature	[°C]	0...60
Storage temperature	[°C]	-20...85
Max. relative air humidity	[%]	90
Protection	IP 65; IP 67	
Tests / approvals		
EMC	DIN EN 60947-5-9	
Vibration resistance	DIN EN 68000-2-6	5 g (10...2000 Hz)
MTTF	[years]	183
UL approval	UL approval number	I012
	File number UL	E174189
Pressure equipment directive	sound engineering practice; can be used for stable gases fluid group 2	
Mechanical data		
Weight	[g]	556
Material	PBT+PC-GF30; PPS GF40; stainless steel (1.4301 / 304); stainless steel (1.4305 / 303); steel (1.5523) galvanised; 2.0401 (brass / CW614N); FKM	
Materials (wetted parts)	EN AW-6082 (aluminium); stainless steel (1.4305 / 303); FKM; ceramics glass passivated; PPS GF40; Al2O3 (ceramics); acrylate	
Process connection	threaded connection G 1/4 DN8	
Displays / operating elements		
Display	Colour display 1,44", 128 x 128 pixels 2 x LED, yellow	

SD5500



Compressed air meter

SDR14DGXFRKG/US-100

Remarks	
Remarks	MW = Measured value
	MEW = Final value of the measuring range
	Measuring, display and setting ranges refer to standard volume flow according to DIN ISO 2533.
	For information about installation and operation please see the operating instructions.
Pack quantity	1 pcs.

Electrical connection

Connector: 1 x M12




SD5500



Compressed air meter

SDR14DGXFRKG/US-100

Connection

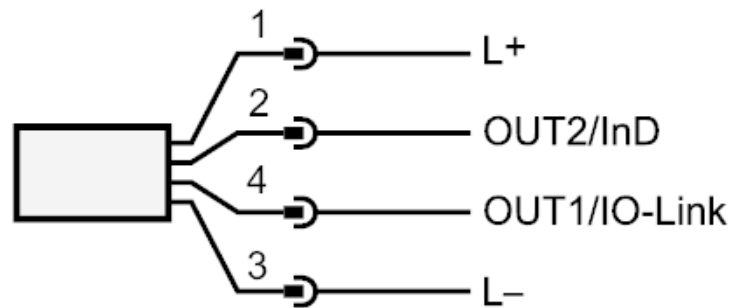

OUT1/IO-Link: Switching output flow
Switching output temperature
Switching output pressure
Pulse output quantity meter
signal output Preset counter

OUT2/InD: Switching output flow
Switching output temperature
Switching output pressure
analog output flow
analog output temperature
analog output pressure
signal output Preset counter
Pulse output quantity meter
Input counter reset